

IMMEDIATE ACTION

SERVICE



BULLETIN

NUMBER 63

August 28, 1942
Rev. Date: 2-20-46

SUBJECT: Stabilizer Aluminum Yoke Casting

MODELS AFFECTED: J3 Series, Serial Nos. 6117, 6130, 6205, 6276, 6282 to 9101 (Incorporating Aluminum Yoke).

J5 Series, Serial Nos. 5-578 and up (Incorporating Aluminum Yoke).

L-4, L-4A and L-4B to Serial No. 9524.


We have received reports of cracks occurring on the bosses thru which the stabilizer adjustment screw passes, in the stabilizer aluminum yoke casting, Piper Part No. 40791. (See Sketch).

As a serious accident may result from failure at this point, it is recommended that an immediate inspection be made of this casting in your airplane, and if any cracks are apparent, the part should be replaced before further operation of the airplane.

It is further suggested that this part of the plane be checked for cracks at the periodic inspections of the airplane in order to preclude a serious failure.

A log book entry of each such inspection should be made.

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.

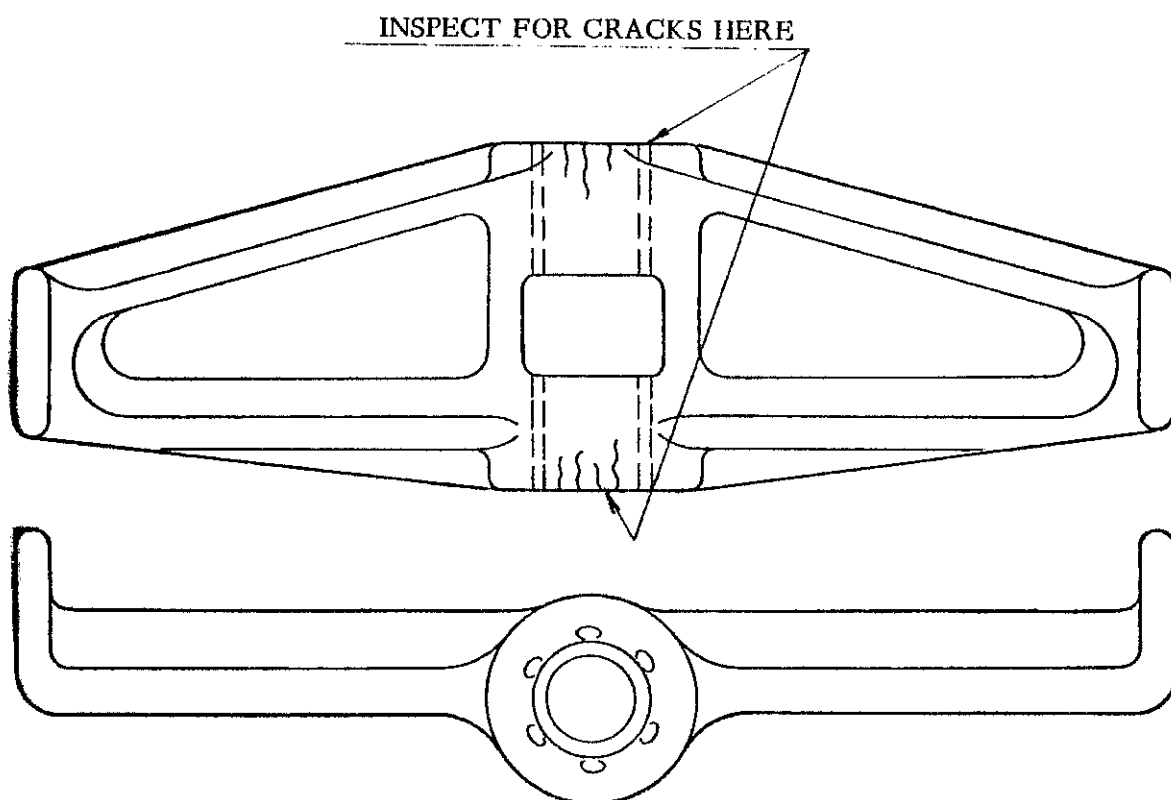

SERVICE BULLETIN NO. 63