

IMMEDIATE ACTION

SERVICE BULLETIN

NUMBER 165

May 22, 1958

SUBJECT: Aileron Hinge Reinforcing Bracket,
Part Number 10931-02


MODELS AFFECTED: J-3, PA-11, PA-15, PA-16, PA-17, L-18B
and L-4 Series

There is a possibility that a few of the subject parts have been supplied to the field during the past three years which were fabricated from aluminum instead of steel. It is requested that the subject brackets on the above mentioned airplanes, which have been replaced since June 1954, be checked to determine the type of material used to make this part. All brackets of aluminum construction must be removed and replaced with a steel bracket, part number 10931-02, which is available through your Piper distributor free of charge.

Please refer to the sketch on the reverse side of this bulletin for the location and identification of the subject bracket.

(Over)

PIPER AIRCRAFT CORPORATION, LOCK HAVEN, PA., U. S. A.

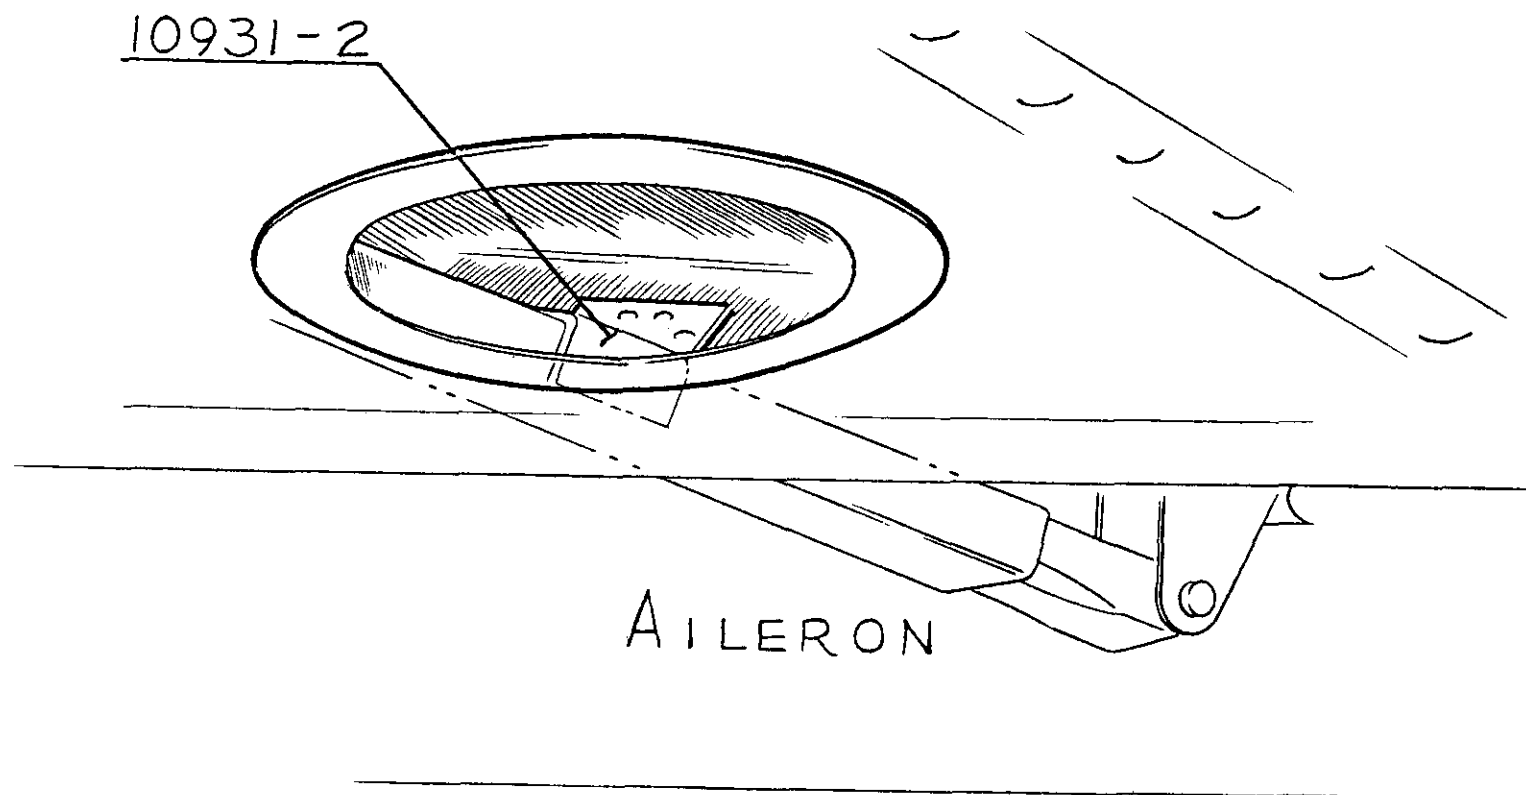

AILERON HINGE REINFORCEMENT BRACKET	
SERVICE BULLETIN	NUMBER 165
PIPER AIRCRAFT CORPORATION	
LOCK HAVEN, PENNSYLVANIA	